


5 903890 000677

AVT EDU638

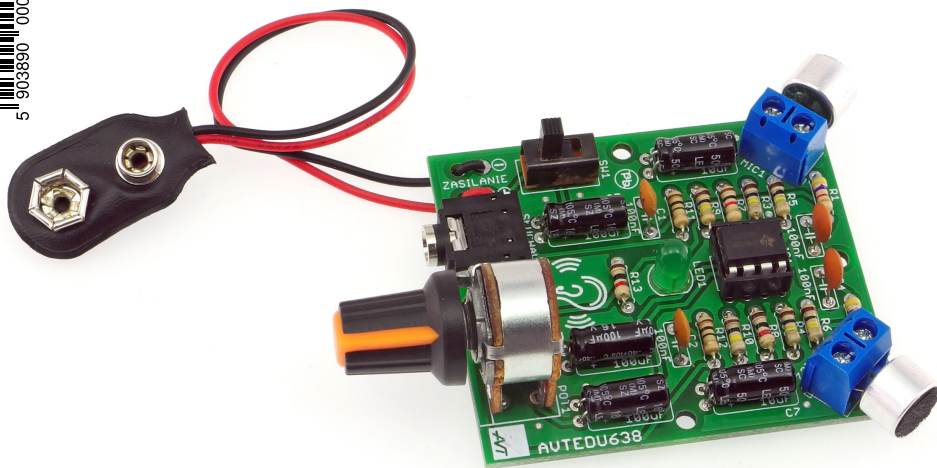

Hear more!

This kit will provide you with a unique auditory experience. Super Ear is perfect for many experiments concerned with amplifying barely discernible sounds, sounds of nature included. With a help of a headphone set you will be able to clearly hear the quietest murmur, rustle, swish or whisper, and even the sounds of insects. The kit can also be helpful for people with hearing problems.

Specifications

- stereo system
- low noise
- fluid amplifier regulation
- headset ready - built-in 3,5 mm socket
- power supply: 9VDC [1×6F22] - battery not included)

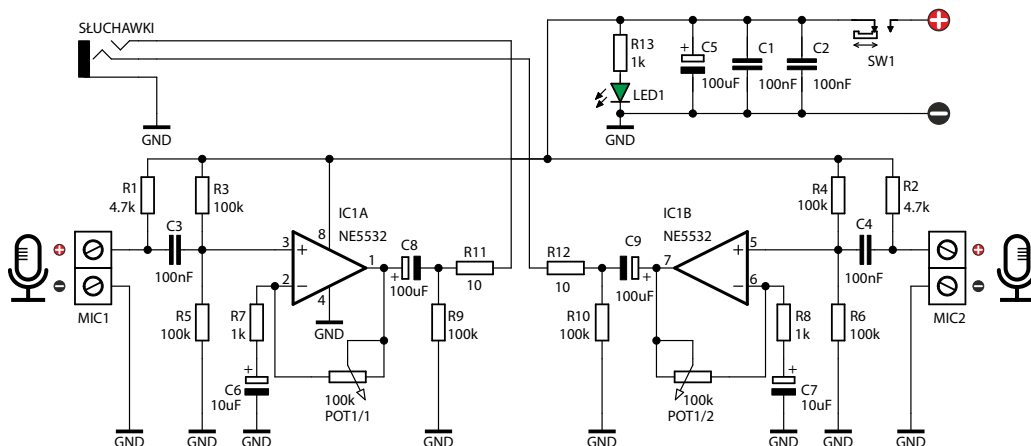


Figure 1. Schematic diagram



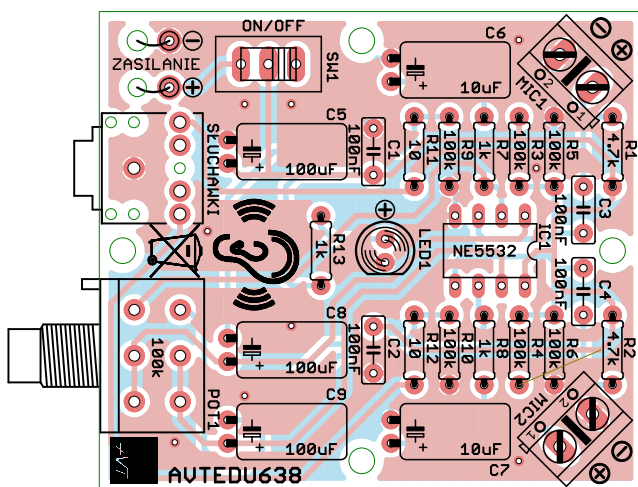


Figure 2. Position of the elements on the printed circuit board

Suggested order of assembly:

R1, R2:.....4.7k Ω (yellow-violet-red-gold)
R3-R6, R9, R10:.....100k Ω (black-brown-yellow-gold)
R7, R8, R13:.....1k Ω (black-brown-red-gold)
R11, R12:.....10 Ω (black-brown-black-gold)
C5, C8, C9:.....100 μ F !
C6, C7:.....10 μ F !
C1, C2, C3, C4:.....100nF
IC1.....NE5532 + IC socket !
3,5mm jack headphone socket
LED1:.....LED diode !
SW1:.....switch
POT1:.....potentiometer 2 \times 100k Ω + knob
MIC1, MIC2:.....screw connectors + microphones!
battery connector: red-positive , black-negative \ominus

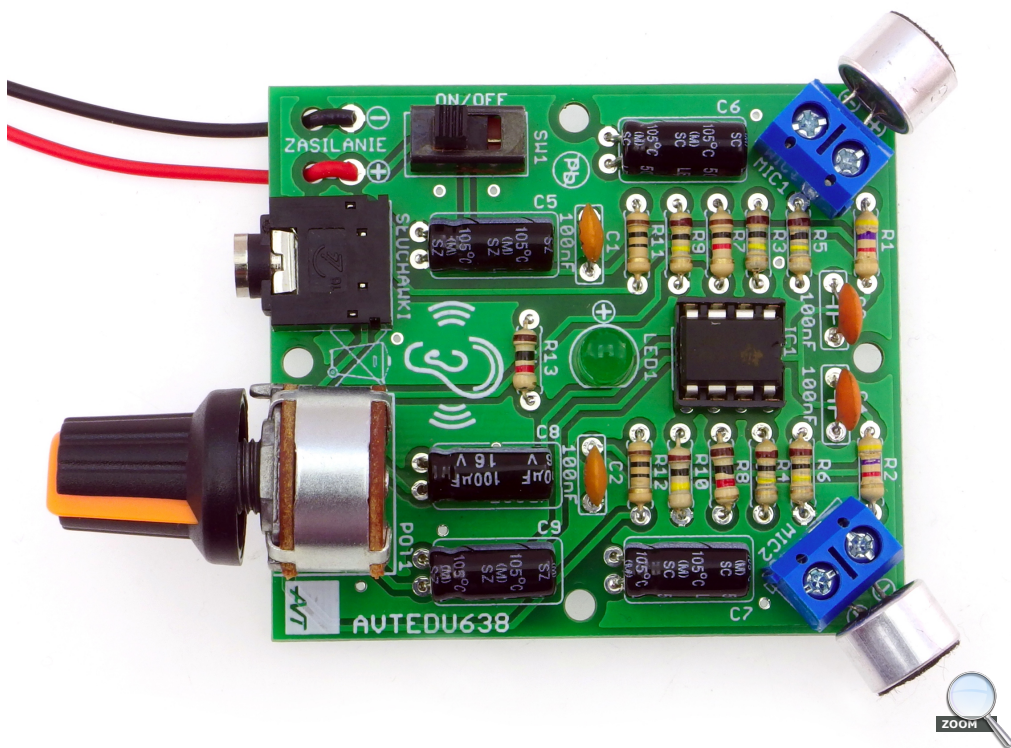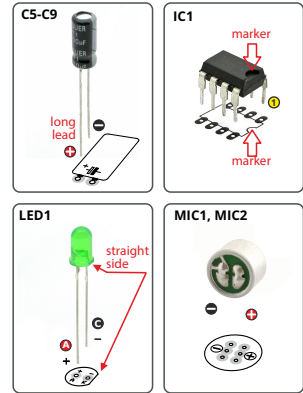


Begin by soldering the elements onto the circuit board in order from smallest to largest.

When assembling the elements marked with "!" pay attention to their polarity and placing of the notch.

You may find the frames with symbols of these elements on the circuit board, as well as photos of the assembled kit helpful.

Assembly instructions

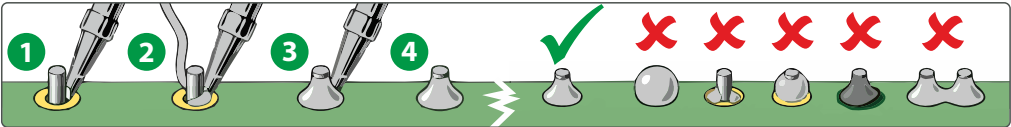


- 1 Touch the tip of the soldering iron to the end of the element near the soldering field
- 2 Next, apply tin solder
- 3 After the cone forms, remove tin solder first, and then the soldering iron
- 4 The whole process should take approx. 2-3 seconds.


The cleanness of the soldered surfaces, right amount of flux in the solder, adequately high temperature (320-360°C), and sufficient amount of solder are necessary to complete a correct bonding.

Too much tin solder can result in forming a ball instead of a cone or joining of two adjacent soldering points.

Inadequate temperature, amount of tin solder or impurities can lead to so called "cold solder joints, i.e. solder and the flux can't moisten the two surfaces and the resulting solder point is fragile and in time will oxidize, break, and stop working.

 Educational Electronics Kits are intended for educational and demonstration purposes only. They are not intended for use in commercial applications. If they are used in such applications the purchaser assumes all responsibility for ensuring compliance with all local laws. In addition, they cannot be used as a part of life support systems, or systems that for use as or as a part of life support systems, or systems that might create a hazardous situation of any kind.

- Failures in modern electronic component are very rare as 95% of non-working kits are due to poor soldering or components placed in the wrong location or orientation so please check your work carefully.

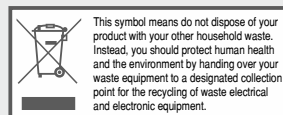

AVI SPV reserves the right to make changes without prior notice.

Assembly and connection of the device not in accordance with the instructions, unauthorized modification of components and any structural modifications may cause damage to the device and endanger the person using it. In this case, the manufacturer and its authorized representatives shall not be liable for any damages arising directly or indirectly from the use or malfunction of the product.